



TROUBLE SHOOTING VERTICAL BLINDS

<u>Problem</u>	<u>Check</u>	<u>Solution</u>
<i>Vanes will not rotate completely closed.</i>	One or more vanes may be out of sync. One or more vanes may be hitting the wall (on OB mount), the floor (on IB or OB mount), or the window (on IB mount). One or more vanes may be hitting the valance.	Pull chain until the vanes have stopped rotating, then continue to pull the chain until all vanes are aligned. Note: A loud clicking noise will be heard, this is normal and will not damage the headrail. Move brackets to clear the obstruction. Move the valance out away from the vanes.
<i>Cord is hard to pull.</i>	Too much tension on cord.	Remount tension pulley.
<i>Vanes will not rotate.</i>	All vanes should be overlapping on the same side.	Manually overlap vanes so that they are all the same.
<i>Too much spacing (light gap) between idle end (end without chain and cord) and first carrier.</i>	Is there a 3/8" spacer between idle end and first carrier.	Carefully remove 3/8" spacer(s) from pinion rod inside track at idle end..
<i>Track sticks/jams half way when traversing, but when pulled harder, will finish traversing.</i>	Inside the headrail, look for a silver bead that is crimped on the cord. This bead will sometimes lose its shape or become loose.	Re-crimp the bead snugly to the cord keeping it as "round" as possible.